

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-458

CORNER DESCRIPTION

● CORNER MONUMENT

N 1/4 Corner of Section 30 Township 16 North Range 5 West

Meridian Indian County Kingfisher

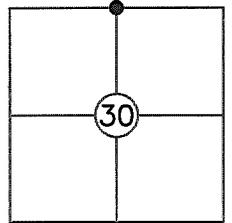

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a post for 1/4 sec cor. deposited charcoal and raised a mound with pits as per instructions.
- 2) OCCR filed by Virgil C. Vaughn, PLS 405 on December 2, 1982. Set 3/8" iron pin and set references.
- 3) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found 1/2" iron pin.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.4 Iron Rod.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No. 4 iron rod and set references.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet	<input checked="" type="checkbox"/> Meters	Grid	<input checked="" type="checkbox"/> Magnetic
1) Mag nail found at NE Corner Section 30.		2639.68	N89°43'53"E	
2) No. 3 Iron Rod found at NW 1/4 Corner Section 30.		2578.60	S89°46'28"W	
3) Set No.4 iron rod with red plastic cap inscribed "Lemke Control"		31.74	N13°03'29"W	
4) Set No.4 iron rod with red plastic cap inscribed "Lemke Control"		33.25	S18°06'56"E	
5) Set No.4 iron rod with red plastic cap inscribed "Lemke Control"		33.45	S21°49'09"W	
6) Face of 4" steel corner post.		108.51	S72°57'06"E	

SKETCH:

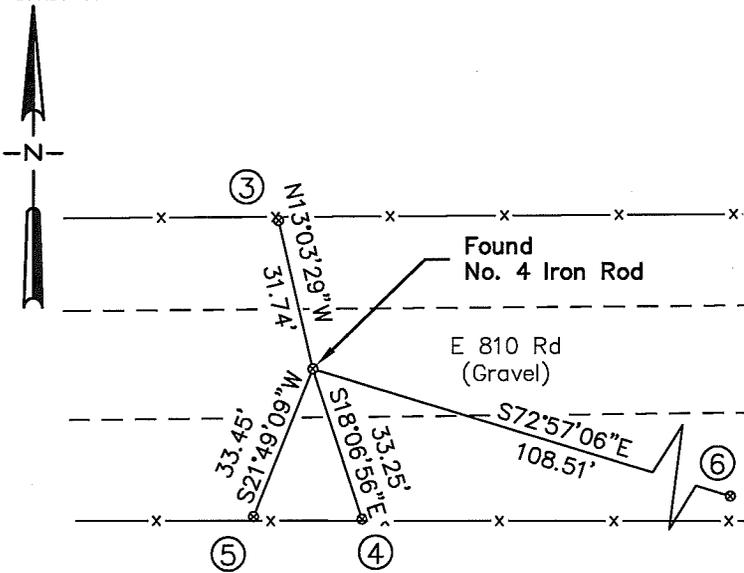

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer
 Signature
 Lemke Land Surveying
 Firm
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
 Tulsa, OK 74136
 City, State, and Zip Code
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
 September 27, 2013 1785
 Date and Registration Number

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2036075.82 Y: 306504.41


ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

SEAL:

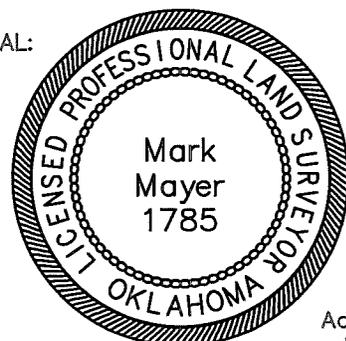

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-459

CORNER DESCRIPTION

CORNER MONUMENT

NE Corner of Section 30 Township 16 North Range 5 West

Meridian Indian County Kingfisher

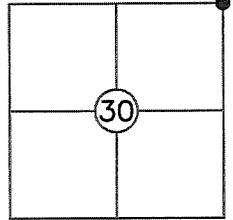

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 18 x 10 x 5 for cor. to secs. 19, 20, 29 and 30.
- 2) OCCR filed by Virgil C. Vaughn, PLS 405 on December 12, 1982. Found RR Spike.
- 3) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found mag nail.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found mag nail 0.1' below surface of asphalt and references per Vaughn and Carroll OCCRs. Nail falls on centerline intersection of roads to north, south, and west and on projected centerline of highway to east.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found mag nail.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No. 4 Iron Rod found at N 1/4 Corner Section 30.	2639.68		S89°43'53"W	
2) No. 3 Iron Rod found at E 1/4 Corner Section 30.	2636.04		S00°12'26"W	
3) Set No.4 iron rod with red plastic cap inscribed "Lemke Control"	49.22		N52°49'34"W	
4) Set No. 4 iron rod with aluminum cap inscribed "Lemke Land Surveying 7401"	118.33		S89°00'01"E	
5) Northwesterly face of 6" diameter steel fence post.	50.27		S52°00'02"E	
6) Found 80d Spike in power pole. 5 inches of spike is exposed.	46.36		S47°15'42"E	
7) Northwesterly face of 6" diameter steel fence post.	73.12		S66°28'55"E	

SKETCH:

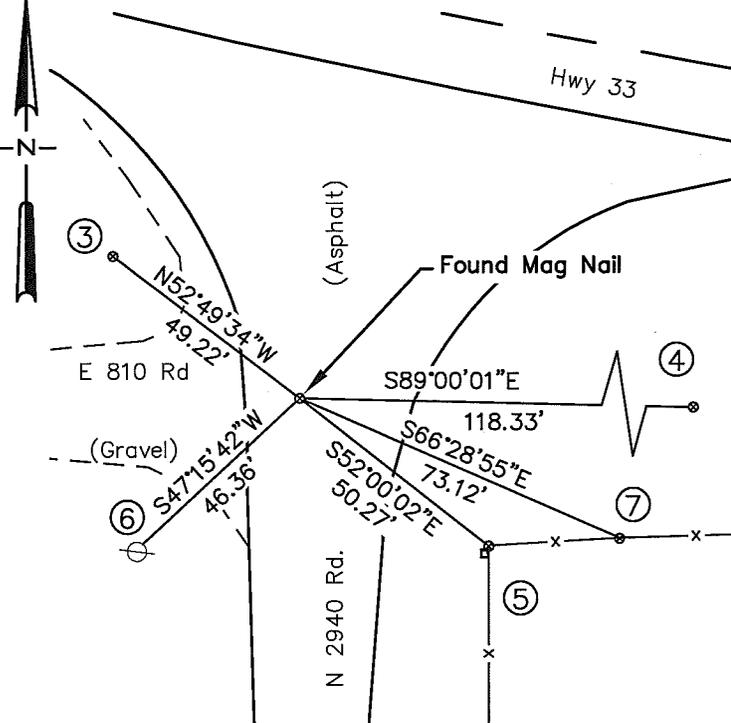

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____
 Lemke Land Surveying
 Firm
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
 Tulsa, OK 74136
 City, State, and Zip Code
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
 September 27, 2013 1785
 Date and Registration Number

OKLAHOMA STATE PLANE COORDINATES: (If Determined)
 X: 2038715.48 Y: 306516.78
 ZONE: NORTH DATUM: NAD83 (2011)
 SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

SEAL:



Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-462

CORNER DESCRIPTION

E 1/4 Corner of Section 30 Township 16 North Range 5 West

Meridian Indian County Kingfisher

CORNER MONUMENT

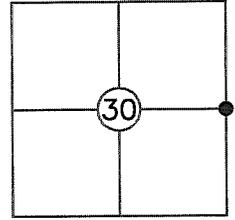

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 18 x 14 x 3 for 1/4 sec cor.
- 2) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found mag nail.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No. 3 iron rod in center of section line road at approximate extensions of fence lines running to east and west. Dimension to one reference agrees with Carroll OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No. 3 Iron Rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) Cotton Gin Spike found at SE Corner Section 30.	2647.10		S00°13'23"W	
2) Mag nail found at NE Corner Section 30.	2636.04		N00°09'38"E	
3) South face of 8" Steel Pipe Fence Corner Post.	45.08		N63°41'47"W	
4) West face of 4" Steel Pipe Fence Post.	39.51		N84°25'02"E	
5) 60d Spike in NE face of power pole, 1.5 feet above ground level.	45.38		S58°15'22"W	


SKETCH:

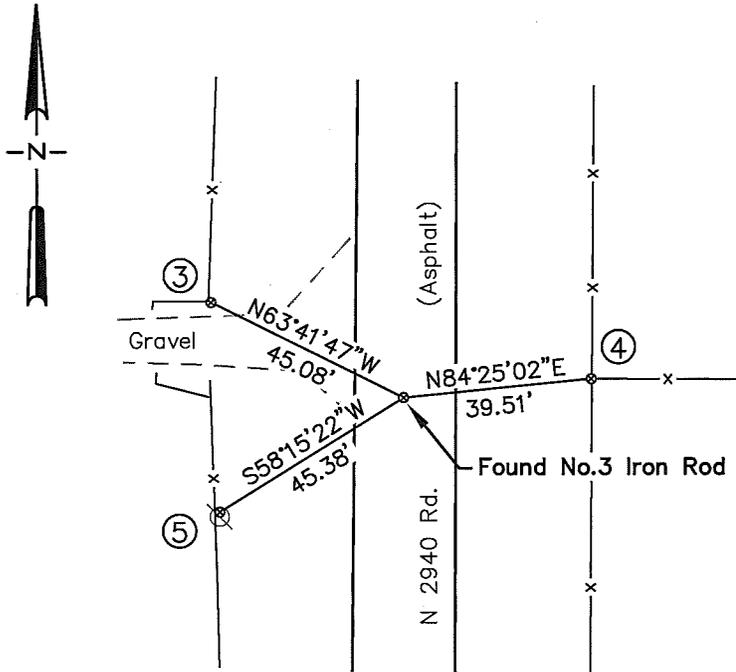

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer
 Signature
 Lemke Land Surveying
 Firm
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
 Tulsa, OK 74136
 City, State, and Zip Code
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
 September 23, 2013 1785
 Date and Registration Number

SEAL:

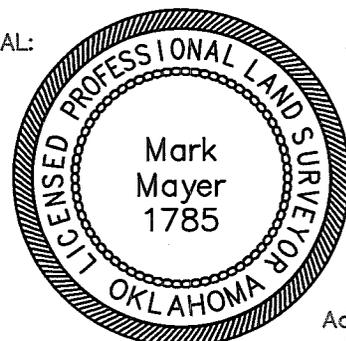

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2038705.94 Y: 303880.75

ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-464

CORNER DESCRIPTION

● CORNER MONUMENT

SW Corner of Section 29 Township 16 North Range 5 West

Meridian Indian County Kingfisher

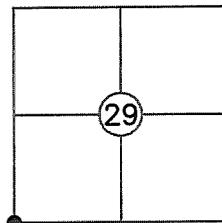

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 18x12x3 For cor. to secs. 29, 30, 31 and 32.
- 2) OCCR filed by Anthony J. Felder, PLS 864 on June 10, 1999. Set Cotton Gin Spindle with Washer RLS #864
- 3) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found Cotton Gin Spindle.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found cotton gin spindle and three references in substantial agreement with Felder and Carroll OCCRs.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found cotton gin spindle.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.3 Iron Rod found at W 1/4 Corner Section 29.	2647.10		N00°13'23"E	
2) No.4 Iron Rod with plastic cap inscribed "Carroll LS 1522" at S 1/4 Corner Section 29.	2634.95		N89°14'38"E	
3) South face of 6" steel fence corner post.	52.07		N50°46'58"W	
4) PK Nail found in SW face of wood fence corner post.	53.65		N48°28'11"E	
5) PK Nail w/steel washer inscribed "RLS 864" found in power pole.	50.53		S60°07'59"E	

SKETCH:

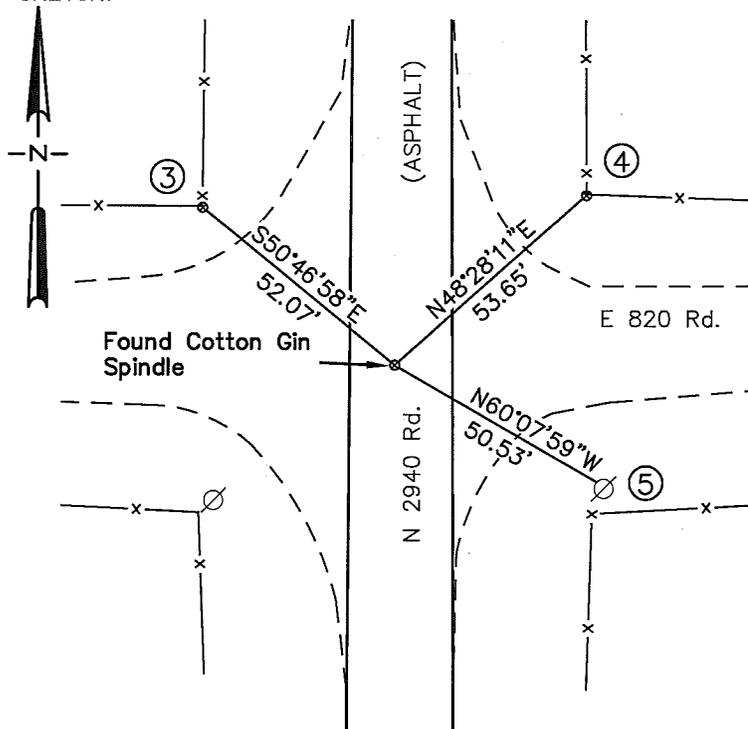

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____
 Firm Lemke Land Surveying
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box _____
 Tulsa, OK 74136
 City, State, and Zip Code _____
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available) _____
 September 17, 2013 1785
 Date and Registration Number _____

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2038695.64 Y: 301233.67


ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

SEAL:

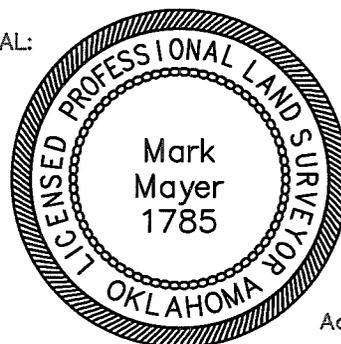

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-465

CORNER DESCRIPTION

S 1/4 Corner of Section 29 Township 16 North Range 5 West

Meridian Indian County Kingfisher

● CORNER MONUMENT

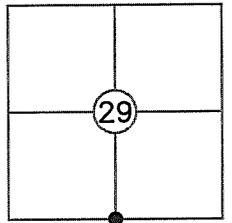

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a post for 1/4 sec cor. deposited charcoal and raised a mound with pits as per instructions.
- 2) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Set 1/2" iron pin using single proportionate measurement.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No. 4 iron rod with plastic cap inscribed "Carroll LS 1522". Iron is within 0.1' of midway point between SW and SE corners of section.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No. 4 Iron Rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) Cotton Gin Spike found at SW Corner Section 29.	2634.95		S89°14'38"W	
2) No.4 Iron Rod with plastic cap inscribed "Carroll LS 1522" at SE Corner Section 29.	2634.96		N89°14'23"E	
3) 60d Spike in Top Center of Wood Fence Post.	36.30		N37°00'25"W	
4) 60d Spike in Top Center of Wood Fence Post.	45.01		N48°40'47"E	
5) 60d Spike in Top Center of Wood Fence Post.	35.94		S03°57'06"E	

SKETCH:

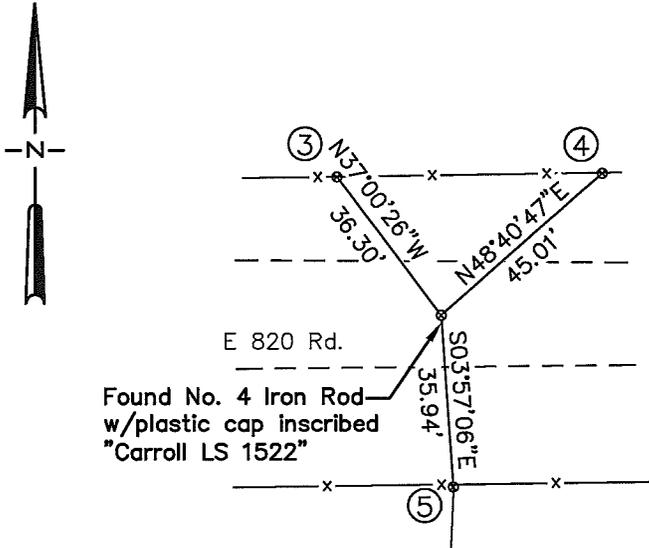

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____

Firm Lemke Land Surveying

Street Address/Post Office Box Suite 120 – 7136 S. Yale Avenue

City, State, and Zip Code Tulsa, OK 74136

Phone Number and E-mail Address (if available) (918) 895-9383 mark.mayer@lemke-ls.com

Date and Registration Number September 24, 2013 1785

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2041330.36 Y: 301268.44

ZONE: NORTH DATUM: NAD83 (2011)


SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____

Archivist, Archives & Records Division
Oklahoma Department of Libraries
200 Northeast 18th Street
Oklahoma City, Ok. 73105

Date: _____

SEAL:

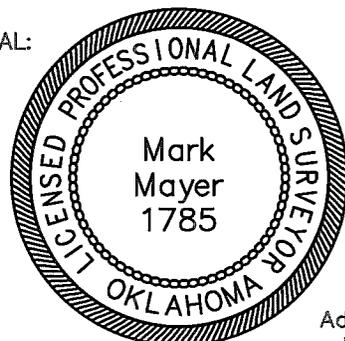

Adopted 12/1/78
Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-466

CORNER DESCRIPTION

SE Corner of Section 29 Township 16 North Range 5 West

Meridian Indian County Kingfisher

● CORNER MONUMENT

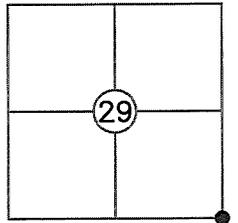

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a post for cor. to secs. 28, 29, 32 and 33, deposited charcoal and raised a mound with pits as per instructions.
- 2) OCCR filed by Anthony J. Felder, PLS 864 on January 30, 1999. Found 60d Spike, set 3/8" rebar with cap.
- 3) OCCR filed by Garren Dodson, PLS 696 on October 6, 2010. Found 3/8" Iron Pin with "CA 980" cap.
- 4) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Set 1/2" iron pin.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No. 4 iron rod with plastic cap inscribed "Carroll LS 1522". References in substantial agreement with those shown on Dodson and Carroll OCCRs. State Plane Coordinates of found monument differ from those reported by Dodson OCCR by ~0.8 feet and from those reported by Carroll by ~1.4 feet.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No. 4 Iron Rod

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet	Meters	Grid	Magnetic
1) No.4 Iron Rod with plastic cap inscribed "Carroll LS 1522" at SE Corner Section 29.	2634.96		S89°14'23"W	
2) No.4 Iron Rod with plastic cap inscribed "Carroll LS 1522" at E 1/4 Corner Section 29.	2631.06		N00°04'59"W	
3) PK Nail with steel washer inscribed "RLS 864" in SE face of 6" wood fence post.	37.82		N45°01'18"W	
4) SW face of 4" steel pipe fence post.	41.45		N51°17'51"E	
5) 60d Spike in SW face of power pole.	46.45		S44°06'54"E	
6) 60d Spike in Top Center of Wood Fence Post.	58.27		S52°00'38"W	

SKETCH:

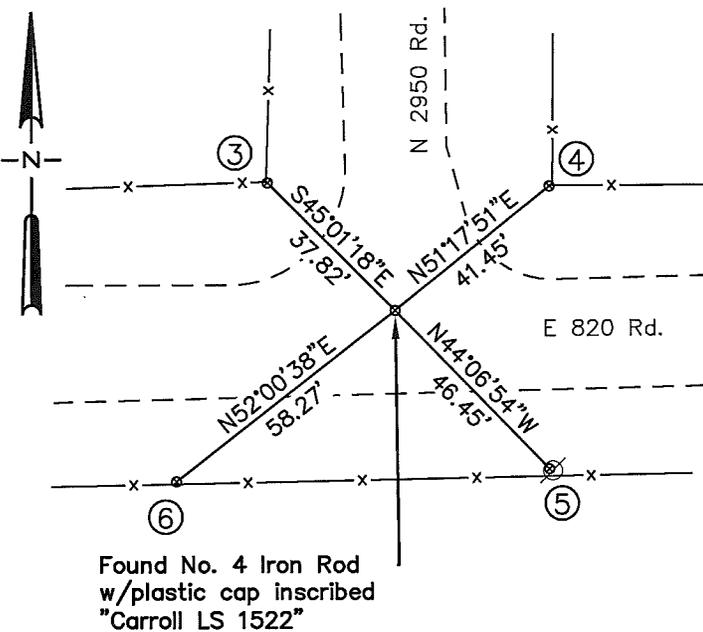

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____

Firm Lemke Land Surveying

Street Address/Post Office Box Suite 120 – 7136 S. Yale Avenue

City, State, and Zip Code Tulsa, OK 74136

Phone Number and E-mail Address (if available) (918) 895-9383 mark.mayer@lemke-ls.com

Date and Registration Number September 24, 2013 1785

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2043965.09 Y: 301303.41

ZONE: NORTH DATUM: NAD83 (2011)


SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____

Archivist, Archives & Records Division
Oklahoma Department of Libraries
200 Northeast 18th Street
Oklahoma City, Ok. 73105

Date: _____

SEAL:

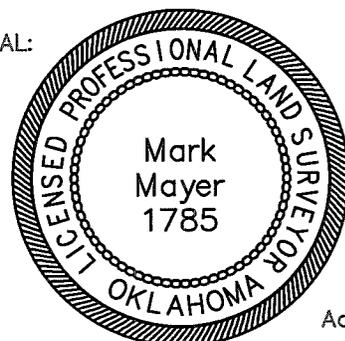

Adopted 12/1/78
Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-461

CORNER DESCRIPTION

● CORNER MONUMENT

NE Corner of Section 29 Township 16 North Range 5 West

Meridian Indian County Kingfisher

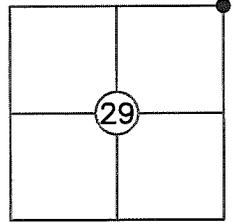

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a post for cor. to secs. 20, 21, 28, 29 deposited charcoal and raised a mound with pits as per Instructions.
- 2) OCCR filed by Garren Dodson, PLS 696 on October 6, 2010. Set 60d Nail with CA3949 tag.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found 60d Spike with tag 1 inch below surface of asphalt. Tag is damaged and illegible. Position is in harmony with 2 references from Dodson OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found 60d Spike. Tied new references.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.8 Iron Rod found at E 1/4 Corner Section 20.			2636.29	N00°21'36"W
2) No.4 Iron Rod with yellow plastic cap inscribed "Carroll LS1522 found at E 1/4 Corner Section 29.			2634.72	S00°09'38"E
3) Mag Nail at N 1/4 corner Section 29			2625.00	S89°24'27"W
4) Found 60d Spike in power pole.			104.89	N15°53'17"E
5) Center of 8" steel bollard (ie/ vertical pipe guard post)			157.08	N59°34'47"E
6) Brass Disk, NGS Control Point "Logan" azimuth mark.			1759.29	N87°49'48"E
7) Brass Disk, NGS Control Point "Logan" reference point no. 3.			100.40	S18°32'08"W
8) Brass Disk, NGS Control Point "Logan" reference point no. 2.			105.17	S60°29'31"W

SKETCH:

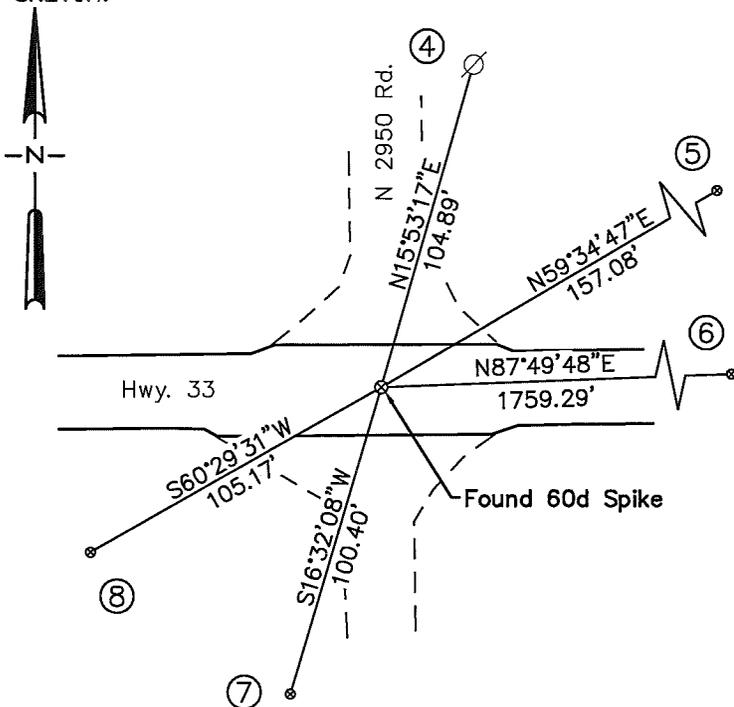

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer


Signature _____
 Firm Lemke Land Surveying
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box _____
 Tulsa, OK 74136
 City, State, and Zip Code _____
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available) _____
 September 17, 2013 1785
 Date and Registration Number _____

OKLAHOMA STATE PLANE COORDINATES: (If Determined)
 X: 2043953.89 Y: 306569.17
 ZONE: NORTH DATUM: NAD83 (2011)
 SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

SEAL:

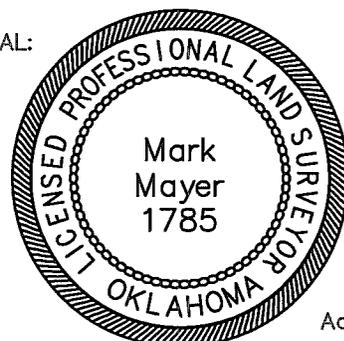

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-460

CORNER DESCRIPTION

N 1/4 Corner of Section 29 Township 16 North Range 5 West

Meridian Indian County Kingfisher

CORNER MONUMENT

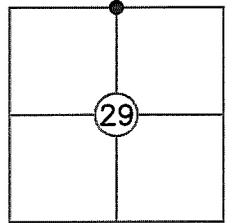

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a sandstone 18x16x2 1/2 for 1/4 sec. cor.
- 2) State of Oklahoma Department of Highways F.A.P. No. F256(13) plans, dated April, 1948.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

No monument found at or near 1/4 corner. Calculated position of 1/4 corner from highway plan ties.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Set mag nail in asphalt with brass washer inscribed "CA 2054". Monument falls in painted centerline of highway at projection of fence lines running to north and to south.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) Mag Nail found at NW Corner Section 29.	2613.67		S89°26'48"W	
2) 60d Spike in asphalt found at NE Corner Section 29.	2625.00		N89°24'27"E	
3) Set No.4 iron rod with red plastic cap inscribed "Lemke Control"	214.47		N86°41'14"E	
4) Set No.4 iron rod with red plastic cap inscribed "Lemke Control"	226.89		S86°30'04"W	
5) South face of 4" steel fence corner post.	50.53		N01°56'30"E	
6) Found No. 6 iron rod at NW corner of concrete culvert headwall.	80.80		N68°11'012"E	

SKETCH:

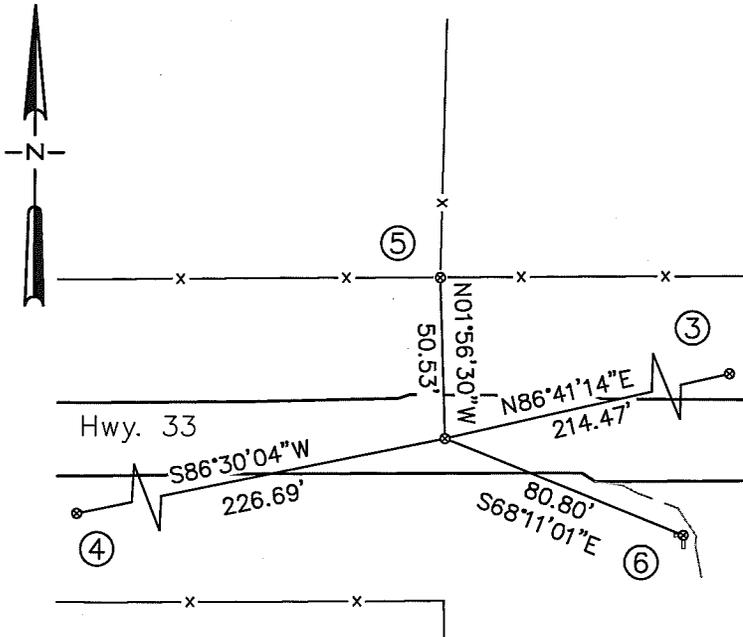


SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____
 Firm Lemke Land Surveying
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box _____
 Tulsa, OK 74136
 City, State, and Zip Code _____
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available) _____
 September 27, 2013 1785
 Date and Registration Number _____

SEAL:

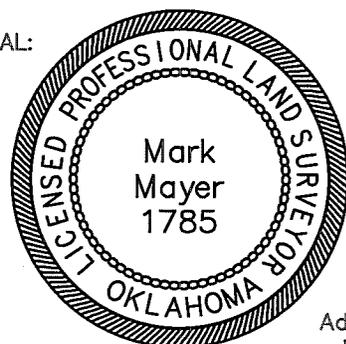

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2041329.03 Y: 306542.02

ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-452

CORNER DESCRIPTION

N 1/4 Corner of Section 20 Township 16 North Range 5 West

Meridian Indian County Kingfisher

● CORNER MONUMENT

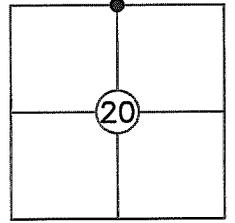

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

1) G.L.O. Notes – October 1871 – Set a Sand Stone 16x14x3 1/2 for 1/4 Sec. cor.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.3 iron rod. Monument is within 4 feet of midway distance between section corners to east and west, and within 1 foot of split between right of way fences on north and south sides of section line road. Also approximately on line with fence lines running to north and to south.

Description of Corner Evidence Set, Method Used and Supporting Evidence Found:


Accepted found No.3 iron rod and tied references.

REFERENCE MEASUREMENTS: (At Least Three)

- 1) No.5 iron rod found at NE corner Section 20.
- 2) No.3 iron rod found at NW corner Section 20.
- 3) 60d Spike set 1 foot AGL in S. face of power pole.
- 4) SW face of 4" diameter steel fence post.
- 5) 40d Nail found 1 foot AGL in N. face of 6" diameter wood fence post.

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
		2608.41	N89°16'09"E	
		2611.97	S89°28'19"W	
		29.40	N07°04'53"W	
		43.38	N40°49'13"E	
		32.15	S00°59'20"E	

SKETCH:

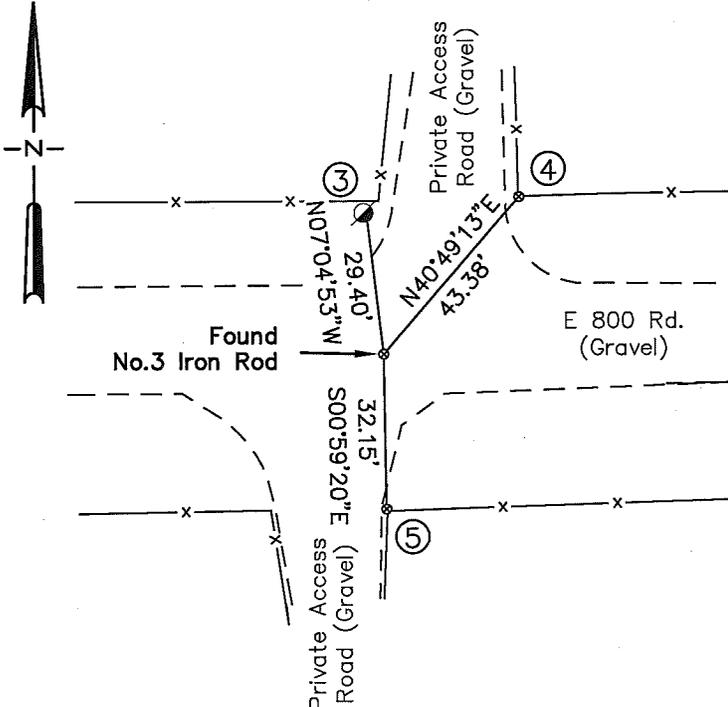

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer


Signature _____
 Lemke Land Surveying _____
 Firm _____
 Suite 120 – 7136 S. Yale Avenue _____
 Street Address/Post Office Box _____
 Tulsa, OK 74136 _____
 City, State, and Zip Code _____
 (918) 895-9383 mark.mayer@lemke-ls.com _____
 Phone Number and E-mail Address (if available) _____
 September 17, 2013 1785 _____
 Date and Registration Number _____

OKLAHOMA STATE PLANE COORDINATES: (If Determined)
 X: 2041312.26 Y: 311804.11
 ZONE: NORTH DATUM: NAD83 (2011)
 SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

SEAL:

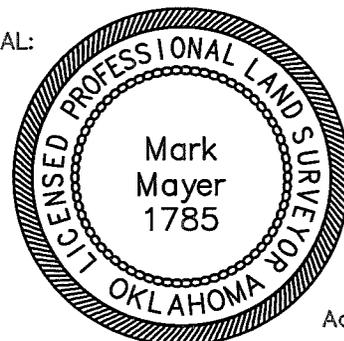

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-453

CORNER DESCRIPTION

● CORNER MONUMENT

NE Corner of Section 20 Township 16 North Range 5 West

Meridian Indian County Kingfisher

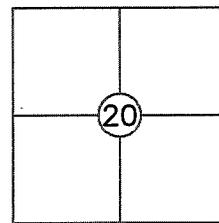

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 16x14x4 for 1/4 sec. cor.
- 2) OCCR filed by Anthony Felder, PLS 864 on Sept. 23, 1991. Found 5/8" rebar.
- 3) OCCR filed by Garren Dodson, PLS 696 on October 6, 2010. Found 5/8" iron pin with 864 cap.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.5 (ie/ 5/8 inch) iron rod with plastic cap inscribed "RLS 864". Position is in harmony with references and state plane coordinates recited on Dodson OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No.5 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.3 iron rod found at N. 1/4 corner Section 20.		2608.41	S89°16'09"W	
2) No.8 iron rod found at E 1/4 corner Section 20.		2632.03	S00°22'02"E	
3) SE face of 6" diameter steel pipe fence post.		47.98	N46°44'00"W	
4) SW face of 8" diameter steel pipe fence post.		55.09	N35°40'08"E	
5) SW face of 8" diameter steel pipe fence post.		55.60	N53°30'31"E	
6) Top center of 4" diameter steel pipe fence post.		46.71	S48°46'30"E	
7) 40d nail found in NE face of 6" diameter wood fence post.		47.00	S44°09'37"W	

SKETCH:

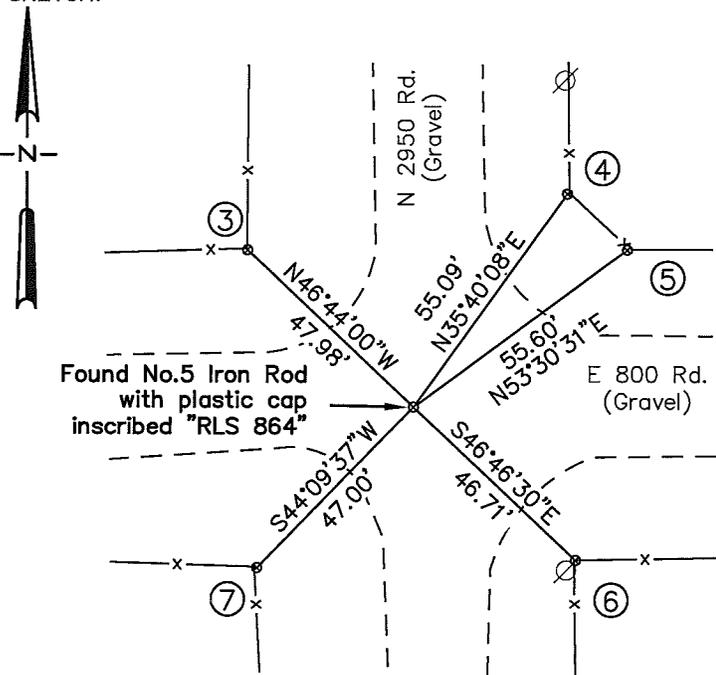

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.


Mark Mayer

Signature _____
 Lemke Land Surveying
 Firm
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
 Tulsa, OK 74136
 City, State, and Zip Code
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
 September 17, 2013 1785
 Date and Registration Number

OKLAHOMA STATE PLANE COORDINATES: (If Determined)
 X: 2043920.45 Y: 311837.38
 ZONE: NORTH DATUM: NAD83 (2011)
 SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

SEAL:

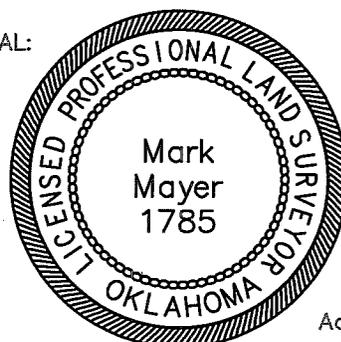

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-456

CORNER DESCRIPTION

E 1/4 Corner of Section 20 Township 16 North Range 5 West

Meridian Indian County Kingfisher

● CORNER MONUMENT

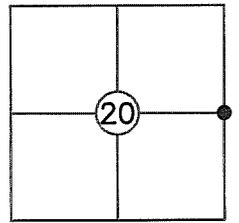

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 16x14x4 for 1/4 sec. cor.
- 2) OCCR filed by Anthony Felder, PLS 864 on Sept. 23, 1991. Found 1" square iron pin.
- 3) OCCR filed by Garren Dodson, PLS 696 on October 6, 2010. Found 1" iron pin.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.8 (ie/ 1 inch) iron rod. Position is in harmony with references from Dodson OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No.8 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.4 iron rod with plastic cap inscribed "RLS 864" found at NE Corner Section 20.	2632.03		N00°22'02"W	
2) 60d Spike at SE corner Section 20.	2636.29		S00°21'36"E	
3) Found 60d Spike in NE face of 6" diameter wood fence post.	48.89		N40°24'23"W	
4) Top center of 4" diameter steel pipe fence post.	71.60		N28°33'51"E	
5) Found 60d Spike in N. face of 8" diameter wood fence post.	33.54		S88°04'25"E	
6) Found 60d Spike in SE face of 8" diameter wood fence post.	32.83		S70°43'23"W	

SKETCH:

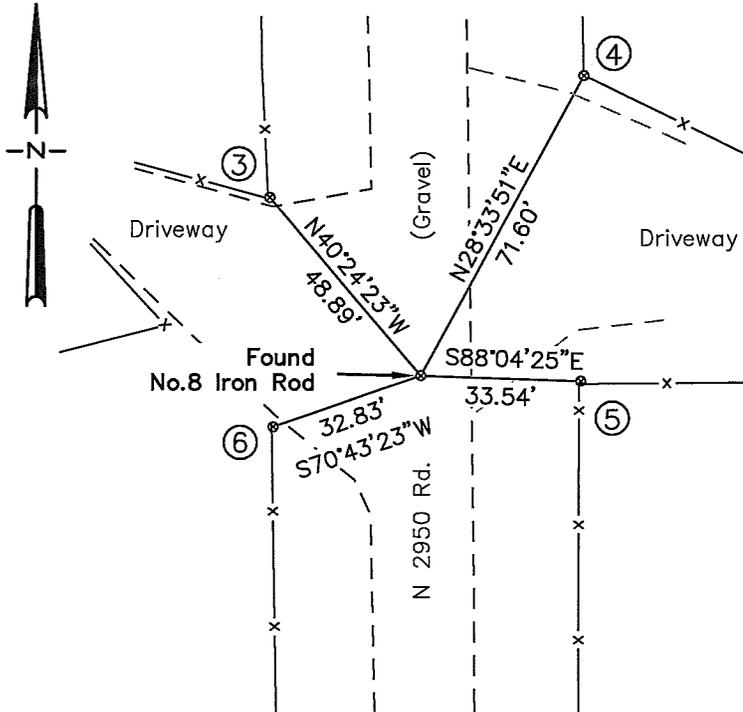

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer
 Signature
Lemke Land Surveying
 Firm
Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
Tulsa, OK 74136
 City, State, and Zip Code
(918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
September 17, 2013 1785
 Date and Registration Number

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2043937.33 Y: 309205.41


ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

SEAL:

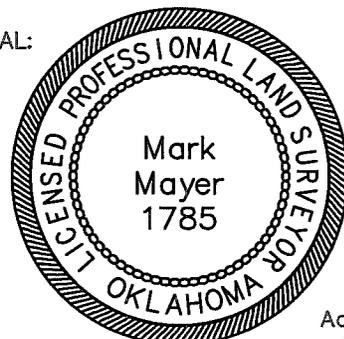

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-457

CORNER DESCRIPTION

SW Corner of Section 19 Township 16 North Range 5 West

Meridian Indian County Kingfisher

● CORNER MONUMENT

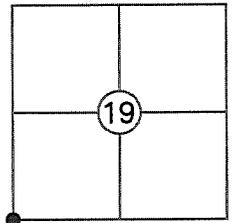

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 18X10X4 for cor. to secs. 19, 24, 25 and 30.
- 2) OCCR filed by Harvey D. Peterson, PLS 1028, on February 2, 1982. Found 1/2" steel rod.
- 3) OCCR filed by Virgil C. Vaughn, PLS 405 on December 2, 1982. Found 3/4" iron pin.
- 4) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found bent 3/8" iron pin.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.3 iron rod and 2 references in harmony with references from Carroll OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No. 3 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.4 Iron Rod found at W 1/4 Corner Section 19.	2645.67		N00°10'15"W	
2) No.4 Iron Rod found at S 1/4 Corner Section 19.	2578.60		N89°46'28"E	
3) 60d Spike found in SE face of power pole	80.99		N24°15'59"W	
4) Face of Steel Fence Post	45.83		S45°14'12"E	
5) Face of Steel Fence Post	42.59		S39°09'39"W	

SKETCH:

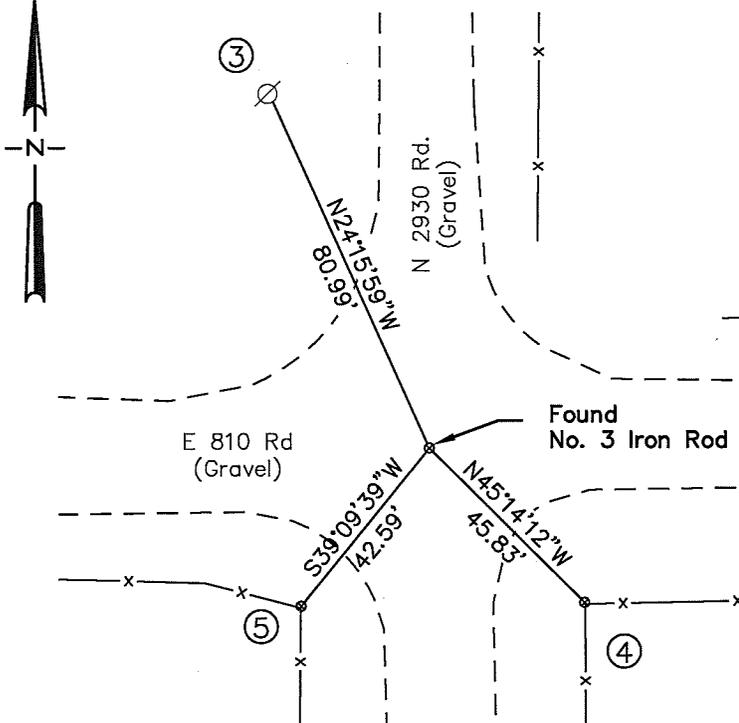

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____

Firm Lemke Land Surveying

Street Address/Post Office Box Suite 120 – 7136 S. Yale Avenue

City, State, and Zip Code Tulsa, OK 74136

Phone Number and E-mail Address (if available) (918) 895-9383 mark.mayer@lemke-ls.com

Date and Registration Number September 27, 2013 1785

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2033497.25 Y: 306494.26

ZONE: NORTH DATUM: NAD83 (2011)


SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____

Archivist, Archives & Records Division
Oklahoma Department of Libraries
200 Northeast 18th Street
Oklahoma City, Ok. 73105

Date: _____

SEAL:

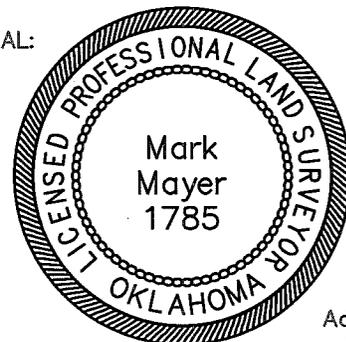

Adopted 12/1/78
Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-454

CORNER DESCRIPTION

CORNER MONUMENT

W 1/4 Corner of Section 19 Township 16 North Range 5 West

Meridian Indian County Kingfisher

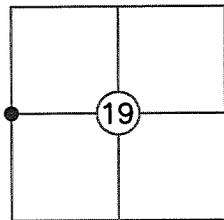

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 18X10X4 for cor. to secs. 19, 24, 25 and 30.
- 2) OCCR filed by Anthony J. Felder, PLS 864 on April 4, 1988. Found 60d Spike over 1/2" rebar.
- 3) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found 1/2" iron pipe.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.4 iron rod and two references in substantial harmony with Felder OCCR. Also found one reference in harmony with Carroll OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No. 4 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet	<input checked="" type="checkbox"/> Meters	Grid	<input checked="" type="checkbox"/> Magnetic
1) No.5 Iron Rod found at NW Corner Section 19.	2638.46		N00°09'42"W	
2) No.3 Iron Rod found at SW Corner Section 19.	2645.67		S00°10'15"E	
3) PK Nail found in north face of power pole, 1.0 ft. AGL.	27.39		N69°52'19"W	
4) 60d Spike found in west face of power pole, 1.0 ft AGL.	32.85		N86°49'07"E	
5) Chisled "x" found in southwest corner of concrete.	37.20		N80°40'56"E	
6) Center of 6" diameter steel post base, sheared off flush with concrete base.	65.40		S23°59'05"W	

SKETCH:

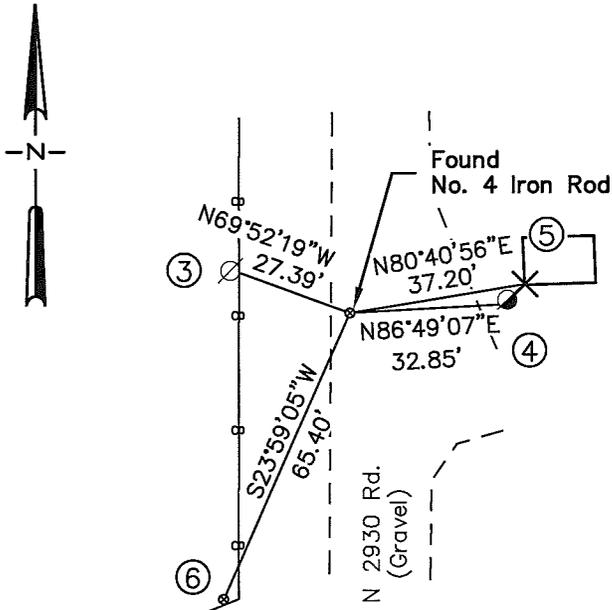

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____

Lemke Land Surveying _____

Firm _____

Suite 120 – 7136 S. Yale Avenue _____

Street Address/Post Office Box _____

Tulsa, OK 74136 _____

City, State, and Zip Code _____

(918) 895-9383 mark.mayer@lemke-ls.com _____

Phone Number and E-mail Address (if available) _____

September 24, 2013 1785 _____

Date and Registration Number _____

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2033489.36 Y: 309139.92

ZONE: NORTH DATUM: NAD83 (2011)


SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____

Archivist, Archives & Records Division
Oklahoma Department of Libraries
200 Northeast 18th Street
Oklahoma City, Ok. 73105

Date: _____

SEAL:

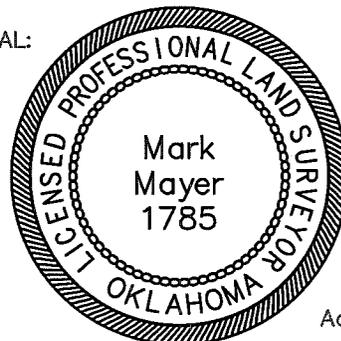

Adopted 12/1/78
Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing Obliterated Lost

C. M. Document No. _____


ODOT Monument No. K-37-449

CORNER DESCRIPTION

NW Corner of Section 19 Township 16 North Range 5 West

Meridian Indian County Kingfisher

CORNER MONUMENT

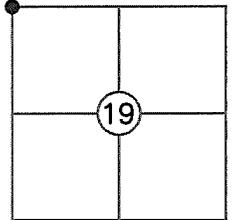

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a Sand Stone 16 x 15 x 4 1/2 for cor. to secs. 13, 18, 19, and 24.
- 2) OCCR filed by Harvey D. Peterson, PLS 1028 on February 12, 1982. Found 1/2" steel rod and set references.
- 3) OCCR filed by Virgil C. Vaughn, PLS 405 on December 12, 1982. Found No.5 iron pin and set references.
- 4) OCCR filed by Jacob Royce Carroll, PLS 1522 on May 29, 2013. Found 1/2" iron pipe.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.6 iron rod and 2 references in substantial compliance with Peterson and Vaughn OCCRs. Also found 2 references in harmony with Carroll OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No.6 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.3 Iron Rod found at N 1/4 Corner Section 19.	2582.76		N89°51'43"E	
2) No.4 Iron Rod found at W 1/4 Corner Section 19.	2638.46		S00°09'42"E	
3) Set cut "X" in concrete bridge railing	70.25		S67°18'18"W	
4) Found 30d Spike in power pole.	37.06		S34°42'46"W	
5) Found 30d Spike in wood fence post.	52.59		N46°33'28"E	
6) Set No.4 iron rod with red plastic cap inscribed "LEMKE CONTROL".	95.38		S25°03'22"E	

SKETCH:

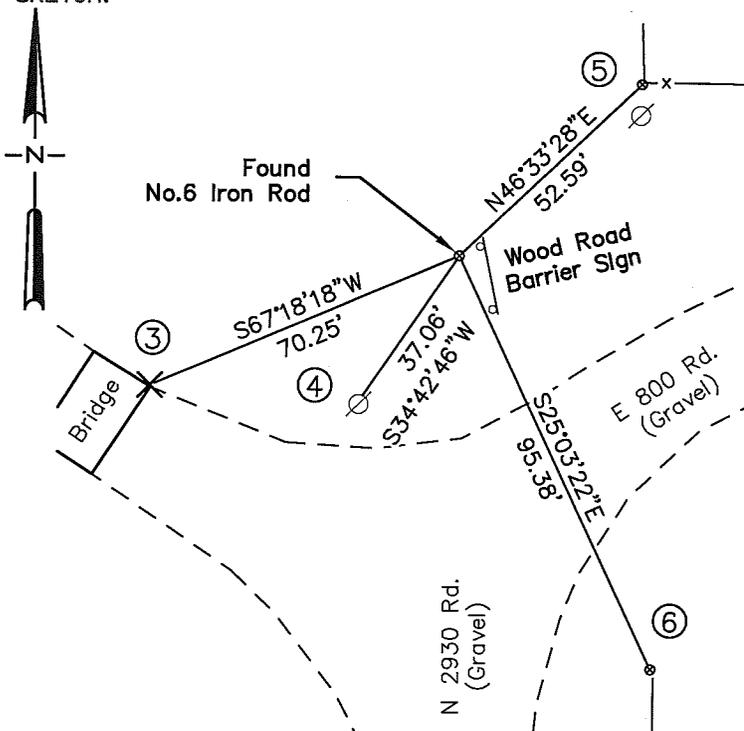


SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____
Lemke Land Surveying
 Firm _____
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box _____
 Tulsa, OK 74136
 City, State, and Zip Code _____
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available) _____
 September 23, 2013 1785
 Date and Registration Number _____

SEAL:

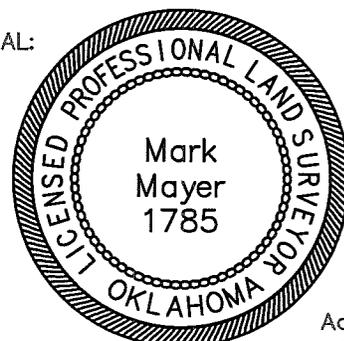

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2033481.91 Y: 311778.37

ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____

Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105

Date: _____

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing Obliterated Lost

C. M. Document No. _____


ODOT Monument No. K-37-450

CORNER DESCRIPTION

N 1/4 Corner of Section 19 Township 16 North Range 5 West

Meridian Indian County Kingfisher

● CORNER MONUMENT

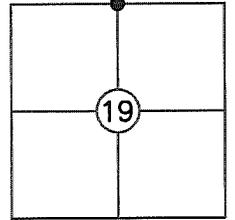

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

1) G.L.O Notes – October 1871 – Set a post for 1/4 sec. cor. deposited charcoal and raised a mound with pits as per Instructions.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.3 iron rod in center of road at projection of fence line to south. Measurements to NW and NE corners of section roughly correspond to GLO proportions.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No.3 iron rod and set references.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.6 Iron Rod found at NW Corner Section 19.		2582.76	S89°51'43"W	
2) No.3 Iron Rod found at NE Corner Section 19.		2635.74	S89°54'03"E	
3) Set No.4 iron rod with red plastic cap inscribed "LEMKE CONTROL".	38.29		N35°48'43"W	
4) Set No.4 iron rod with red plastic cap inscribed "LEMKE CONTROL".	34.08		N23°16'18"E	
5) Set No.4 iron rod with red plastic cap inscribed "LEMKE CONTROL".	31.30		S11°26'03"W	

SKETCH:

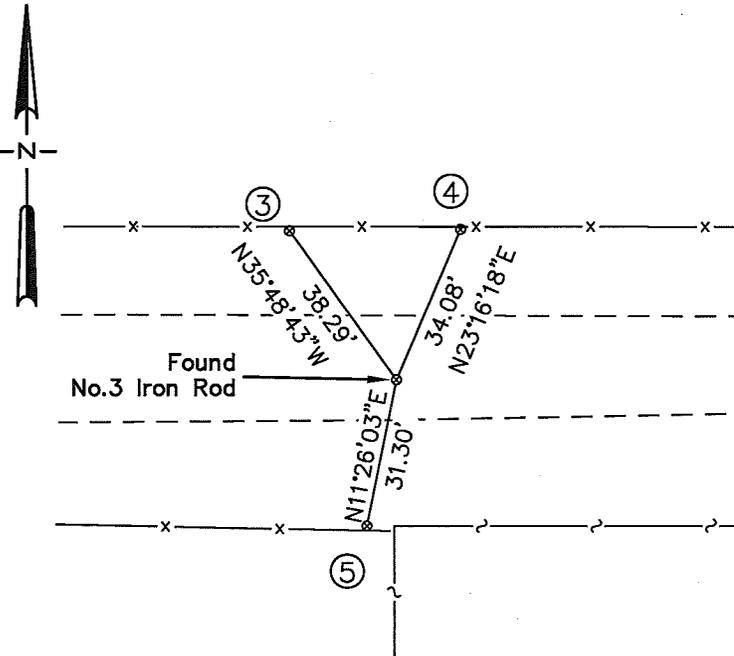

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.


Mark Mayer

Signature
Lemke Land Surveying
 Firm
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
 Tulsa, OK 74136
 City, State, and Zip Code
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
 September 24, 2013 1785
 Date and Registration Number

OKLAHOMA STATE PLANE COORDINATES: (If Determined)
 X: 2036064.66 Y: 311784.60
 ZONE: NORTH DATUM: NAD83 (2011)
 SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105
 Date: _____

SEAL:

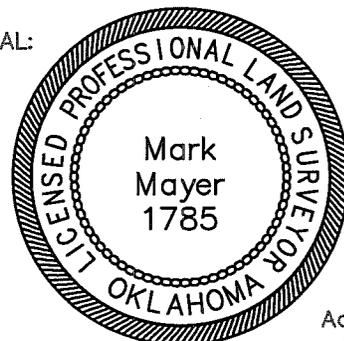

Adopted 12/1/78
 Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing X Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-455

CORNER DESCRIPTION

● CORNER MONUMENT

E 1/4 Corner of Section 19 Township 16 North Range 5 West

Meridian Indian County Kingfisher

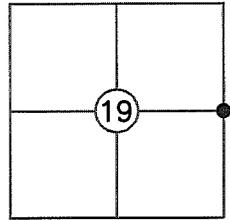

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a post for 1/4 sec. cor. deposited charcoal and raised a mound with pits as per Instructions..
- 2) OCCR filed by Virgil C. Vaughn, PLS 405 on December 2, 1982. Found 3/8" iron pin.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.3 iron rod 2.1 feet below road surface and 1 reference in substantial compliance with Vaughn OCCR. Monument falls near center of road and on projection of fence line to east.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No.3 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)

Description	Distance		Bearing	
	Feet	Meters	Grid	Magnetic
1) No.3 Iron Rod found at NE Corner Section 19.				
2) Mag nail found at SE Corner Section 19.				
3) 40d Nail found in South face of power pole.				
4) West face of 4" Steel fence post.				
5) NE face of 6" wood fence post				

SKETCH:

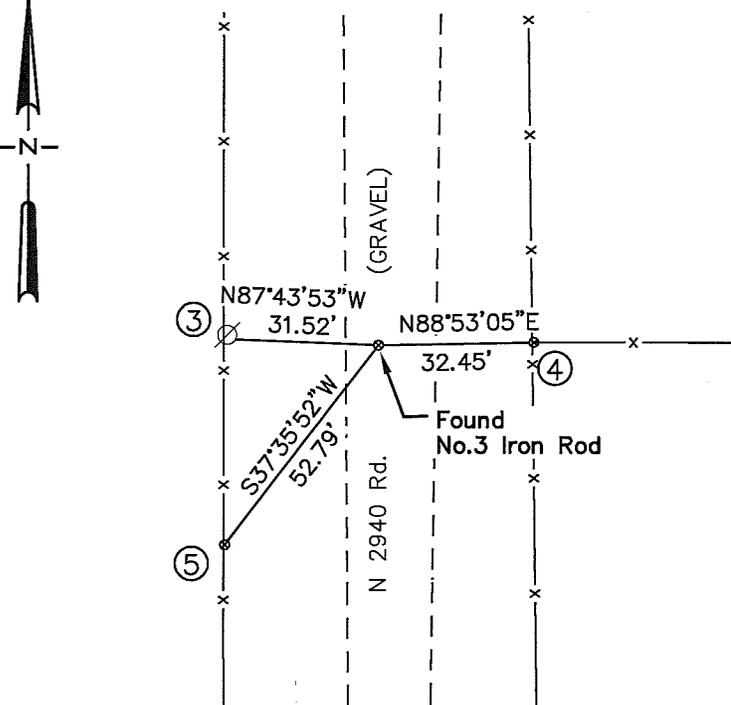

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____

Firm Lemke Land Surveying

Street Address/Post Office Box Suite 120 – 7136 S. Yale Avenue

City, State, and Zip Code Tulsa, OK 74136

Phone Number and E-mail Address (if available) (918) 895-9383 mark.mayer@lemke-ls.com

Date and Registration Number September 23, 2013 1785

OKLAHOMA STATE PLANE COORDINATES: (If Determined)

X: 2038707.78 Y: 309148.29

ZONE: NORTH DATUM: NAD83 (2011)

SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____

Archivist, Archives & Records Division
Oklahoma Department of Libraries
200 Northeast 18th Street
Oklahoma City, Ok. 73105

Date: _____

SEAL:



Adopted 12/1/78
Revised 1/1/05

OKLAHOMA CERTIFIED CORNER RECORD

Existing Obliterated _____ Lost _____

C. M. Document No. _____


ODOT Monument No. K-37-451

CORNER DESCRIPTION

NE Corner of Section 19 Township 16 North Range 5 West

Meridian Indian County Kingfisher

CORNER MONUMENT

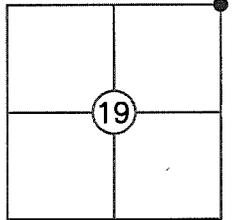

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

- 1) G.L.O. Notes – October 1871 – Set a post for cor. to secs. 17, 18, 19, 20 deposited charcoal and raised a mound with pits as per Instructions.
- 2) OCCR filed by Virgil C. Vaughn, PLS 405 on December 2, 1982. Found 3/8" iron pin.

MONUMENT DESCRIPTION:

Description of Corner Evidence Found and Supporting Evidence:

Found No.3 iron rod and 3 references in substantial compliance with Vaughn OCCR.


Description of Corner Evidence Set, Method Used and Supporting Evidence Found:

Accepted found No.3 iron rod.

REFERENCE MEASUREMENTS: (At Least Three)
Description

Description	Distance		Bearing	
	Feet <input checked="" type="checkbox"/>	Meters <input type="checkbox"/>	Grid <input checked="" type="checkbox"/>	Magnetic <input type="checkbox"/>
1) No.3 Iron Rod found at N 1/4 Corner Section 19.	2635.74		N89°54'03"W	
2) No.3 Iron Rod found at N 1/4 Corner Section 20.	2611.97		N89°28'19"E	
3) No.3 Iron Rod found at E 1/4 Corner Section 19.	2631.75		S00°09'39"E	
4) 40d Nail found in SW face of leaning wood fence post.	47.70		N44°57'11"W	
5) 30d nail found in SW face of power pole.	52.98		N65°44'17"E	
6) 60d spike found in NW face of power pole	56.29		S59°00'04"E	

SKETCH:

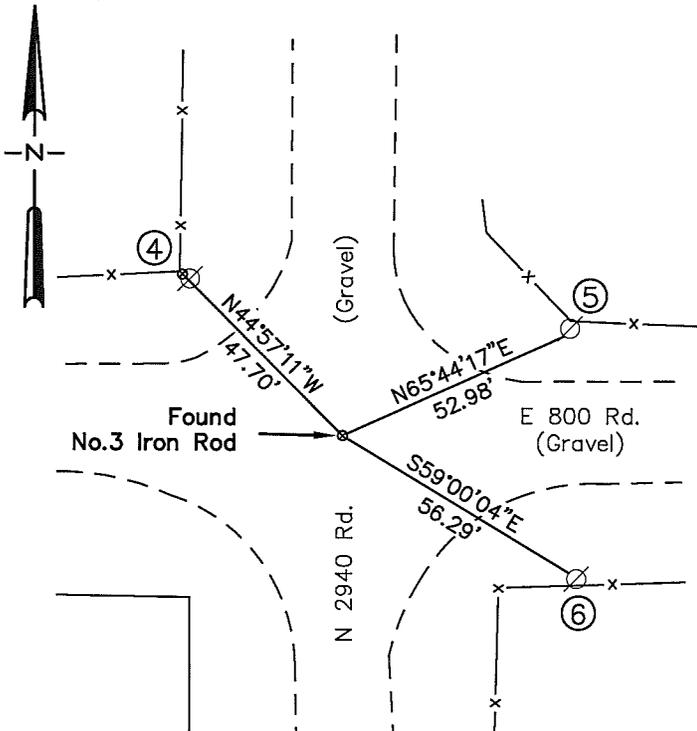


SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any prior filings prior to making this survey.

Mark Mayer

Signature _____
 Firm Lemke Land Surveying
 Suite 120 – 7136 S. Yale Avenue
 Street Address/Post Office Box
 Tulsa, OK 74136
 City, State, and Zip Code
 (918) 895-9383 mark.mayer@lemke-ls.com
 Phone Number and E-mail Address (if available)
 September 23, 2013 1785
 Date and Registration Number

SEAL:

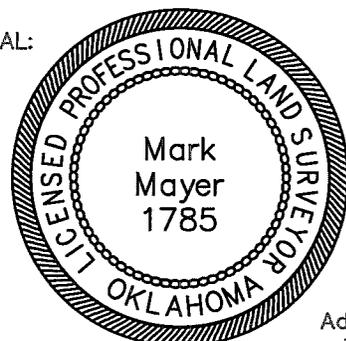

OKLAHOMA STATE PLANE COORDINATES: (If Determined)
 X: 2038700.40 Y: 311780.03
 ZONE: NORTH DATUM: NAD83 (2011)
 SOURCE: GPS-RTK Vector Relative to OPUS positioned base.

Accepted and Filed: _____
 Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Ok. 73105
 Date: _____

Adopted 12/1/78
 Revised 1/1/05